

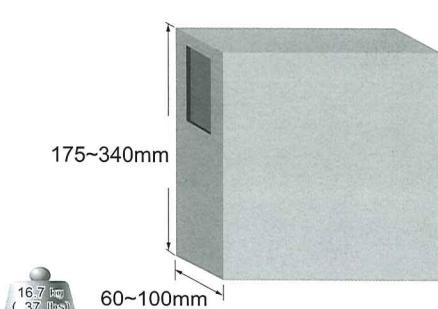
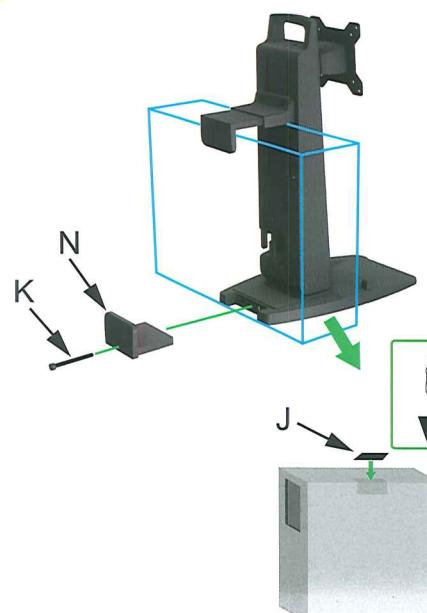
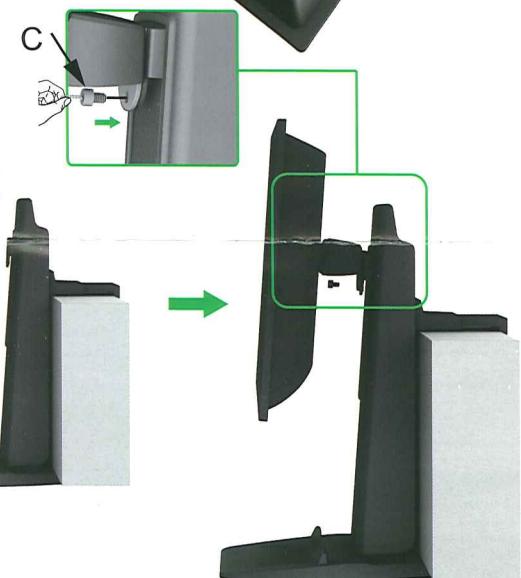
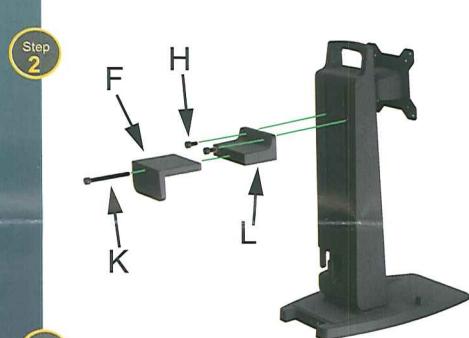
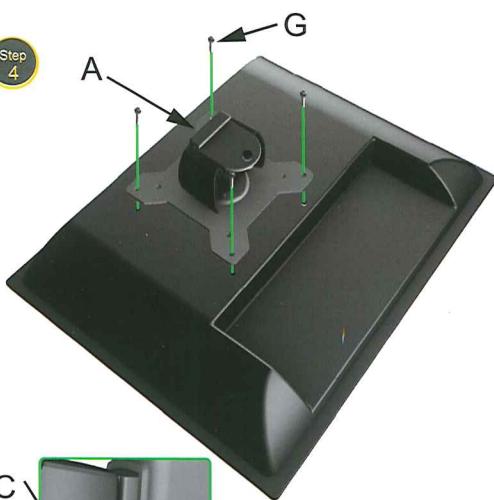



Installation Process

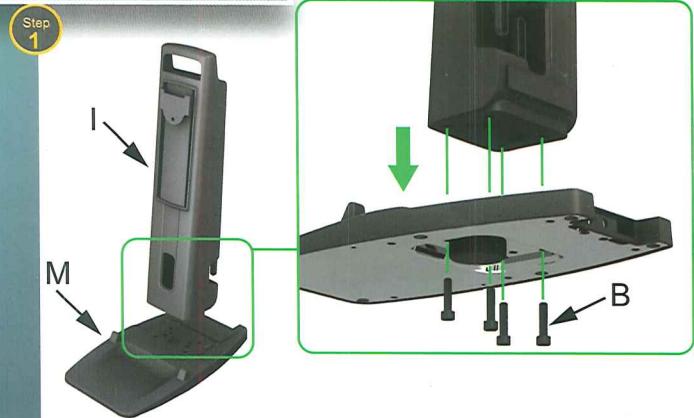


Tilt Torque Adjustment

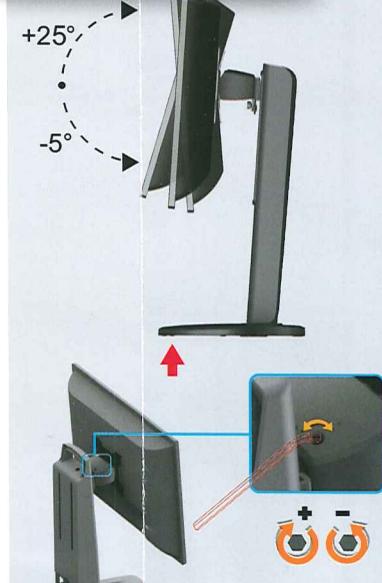


Rotate

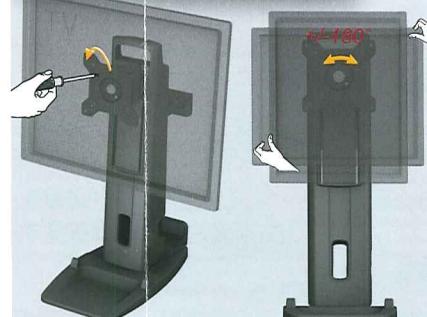

Height Torque Adjustment

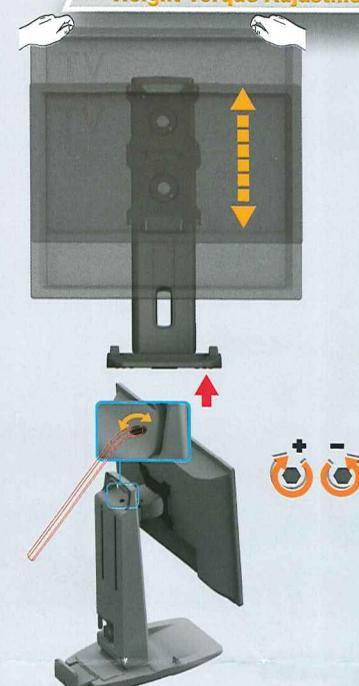

Cable Management

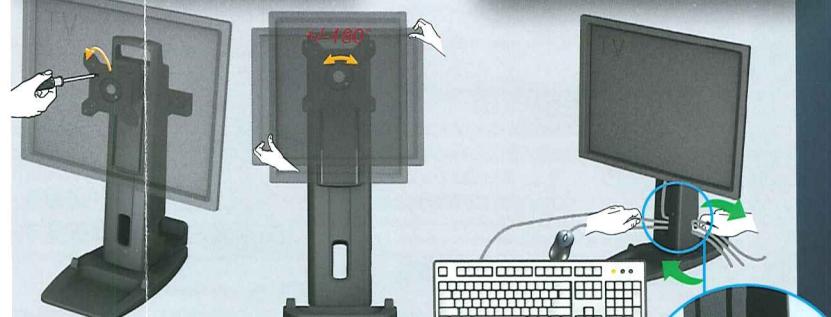

2 x M4 threaded screw inserts are located at the bottom of the base to allow attachment of the stand to a work surface.

Screws are not supplied, if required it is recommended that the screws length is - Surface thickness + at least 10mm

